Farm Structures FACTSHEET



Order No. 305.800-1 Revised December 2015

HAY FLOOR SAFETY FENCE

According to reports from WorksafeBC, several serious injuries have occurred when farm workers have fallen from the hay floors of drive-through dairy barns onto the hard concrete alley below. These accidents occur when a bale-tie breaks and the worker falls backwards or when the worker loses his footing while working on top of the stack or when a worker steps on a bale near the edge of the hay floor and it is not interlocked with the stack.


Extra caution is called for when working on the hay floor and the worker must be constantly aware of where he is in relation to the edge at all times.

WorksafeBC and the Ministry of Agriculture strongly recommend that all dairy producers with this type of open hay-floor install a safety fence according to the detail shown in the accompanying plan. (Plan No. 305.800-1)

The fence is designed so that it gives the worker full security from falling off the floor into the drive-through alley and it will retain the stacked hay so that it cannot fall. The provision of four-foot wide openings every 36 feet allows for the placement of hay elevators for loading the floor. Elevators can be raised in these openings as the stack rises. The two-foot gap below the wire allows the worker to kick bales off the floor.

The fence is constructed of 4 x 6 framing secured together with framing clips. The wire mesh can be purchased in rolls up to seven feet wide and is secured with heavy duty, nailed staples. Note that the top of the vertical members are framed into the trusses so that the trusses can deflect without interference from the member. The bases of the vertical members are fastened to the hay-floor with heavy-duty post brackets. The vertical members are normally spaced at 12-foot centres to match the spacing of the building posts to retain an orderly appearance inside the barn.

Factsheet 305.800-1 Page 1 of 3

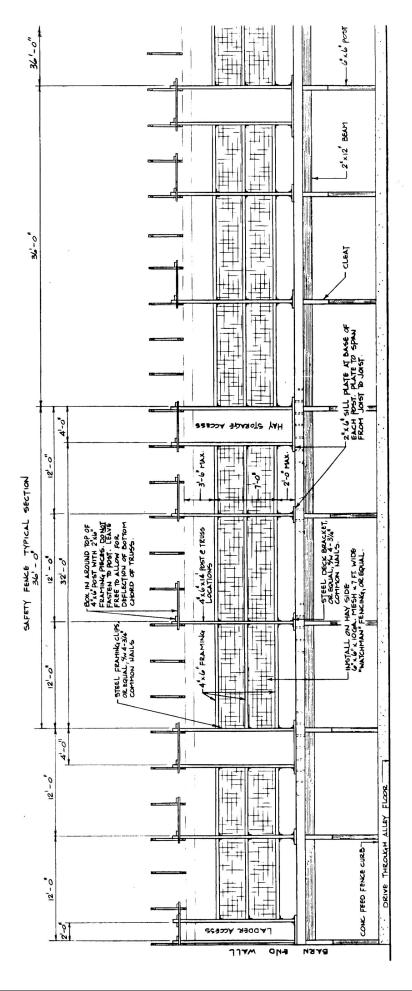


HAY FLOOR SAFETY FENCE

(FOR OPTIONAL HAY FLOOR)

FRONT ELEVATION

Factsheet 305.800-1 Page 2 of 3

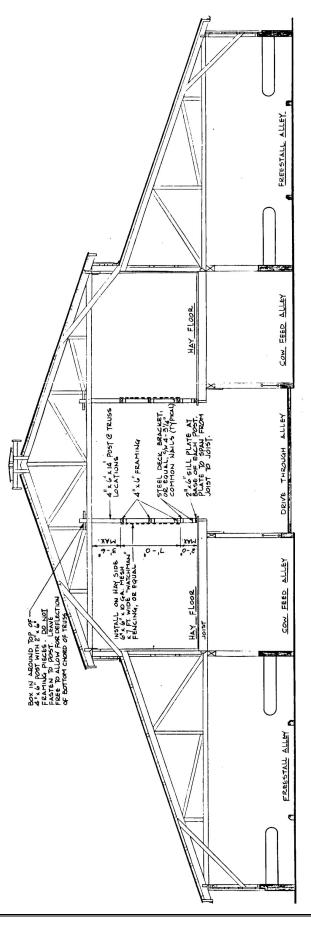

CROSS - SECTION

FOR FURTHER INFORMATION CONTACT John Luymes, Farm Structures Engineer

Phone: (604) 556-3114

Email: John.Luymes@gems7.gov.bc.ca

RESOURCE MANAGEMENT BRANCH

Ministry of Agriculture and Food 1767 Angus Campbell Road Abbotsford, BC CANADA V3G 2M3

Factsheet 305.800-1 Page 3 of 3