



VALLEY TESTING & ENGINEERING

#18 - 3275 McCallum Road ph: 1-888-855-9733
 Abbotsford, B.C. V2S 7W8 fax: (604) 855-7378

**SIEVE ANALYSIS REPORT
 8 16 30 50 SERIES**

TO Site ACTIVE EARTH ENGINEERING LTD
 4510 SADDLEHORN CRESCENT
 LANGLEY, BC
 V2Z 1J6

PROJECT NO. V8430
 CLIENT ACTIVE EARTH ENGINEERING LTD
 C.C.


ATTN: SEAN REILLY

PROJECT SIEVE TESTING
 AGGREGATE TESTING
 CONTRACTOR ACTIVE EARTH ENGINEERING

11932 TANNERY ROAD
 SURREY

SIEVE TEST NO. 2 DATE RECEIVED 2017.Mar.24 DATE TESTED 2017.Mar.27 DATE SAMPLED 2017.Mar.24

SUPPLIER AEE SOURCE COMPOSITE FROM STOCKPILE SPECIFICATION MATERIAL TYPE SILTY SAND W/ GRAVEL (SAMPLE #2)
 SAMPLED BY CLIENT TESTED BY CF/JR TEST METHOD ASTM C-136

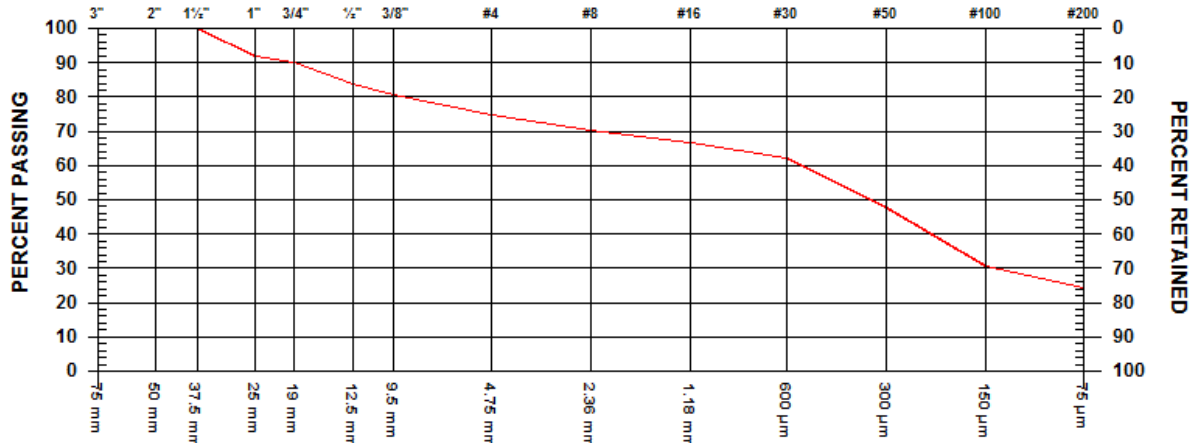

| GRAVEL SIZES | PERCENT PASSING | GRADATION LIMITS | SAND SIZES AND FINES | PERCENT PASSING | GRADATION LIMITS |
|----------------|-----------------|------------------|----------------------|-----------------|------------------|
| 3" 75 mm | | | No. 4 4.75 mm | 74.9 | |
| 2" 50 mm | | | No. 8 2.36 mm | 70.4 | |
| 1 1/2" 37.5 mm | 100.0 | | No. 16 1.18 mm | 66.5 | |
| 1" 25 mm | 92.0 | | No. 30 600 µm | 62.3 | |
| 3/4" 19 mm | 90.3 | | No. 50 300 µm | 47.9 | |
| 1/2" 12.5 mm | 84.0 | | No. 100 150 µm | 30.8 | |
| 3/8" 9.5 mm | 80.8 | | No. 200 75 µm | 24.1 | |

COMMENTS
 SAMPLED @ EXPPOSED FACE, TANNERY ROAD SIDE

C/O SEAN REILLY (604-828-1441)

Page 1 of 1 2017.Mar.27 VALLEY TESTING & ENGINEERING PER.

Reporting of these test results constitutes a testing service only. Engineering interpretation or evaluation of test results is provided only on written request.

Report System Control Registered: Valley Testing & Engineering Ltd. Abbotsford

All tested materials will be stored for one week only.