





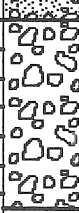



PROJECT: Site Remediation & Monitoring
CLIENT: District of North Vancouver
PROJECT No: N03.210
SITE: North Vancouver Tennis Centre
LOCATION: 300 Lloyd Avenue, North Vancouver, BC

Boring No.: MW98-1

NORTHING: 492396.2

EASTING: 5463049.2

| SUBSURFACE PROFILE | | | | SOIL SAMPLE | | | Well Data | Comments |
|--------------------|--|--|---------------|---------------|--|--------------|-----------|---|
| Depth (m) | Symbol | Soil Description | Elevation (m) | Sample Number | Type | Lab Analysis | | |
| 0 | | Ground Surface | 0 | | | | | |
| 0 to 1.126 |  | | | |  | | | 1.126 m stick up Concrete |
| 1 to 1.55 |  | SAND medium grained, with medium to coarse subrounded gravel, up to 70 mm, rootlets to 0.7 m, dense, medium brown, no odour. | -1.55 | 1 |  | | | Drill cuttings open hole caved |
| 1.55 to 3.2 |  | SAND and GRAVEL well graded, up to 100 mm, trace fines, dense, wet, orange brown, no odour, iron precipitate on soil. | | 2 |  | | | Bentonite Silica filter sand |
| 3.2 to 4.5 |  | GRAVEL well graded, some sand, medium to coarse grained, dense, wet, medium brown, no odour | -3.2 | 3 |  | | | Groundwater elevation @ 2.65 m above MSL Dec. 4, 1998 Groundwater analysis: Dissolved Metals 010 50mm dia. slotted PVC screen |
| 4.5 to 4.5 | | End of Borehole | -4.5 | | | | | difficult drilling |
| 5 to 8 | | | | | | | | |



TECHNOLOGY RESOURCE INC.
 500-100 Park Royal South
 West Vancouver, BC
 V7T 1A2

DRILLER: Uniwide Drilling Ltd.
METHOD: 200mm O.D. Solid Stem Auger
DEPTH: 4.50 m
DATUM: Mean Sea Level (MSL)

DATE: December 4, 1998
LOGGED BY: AP
CHECKED BY: JM
SHEET: 1 of 1